Technical Update (November 2003)
Astro and Zenith
New 001 & 002 chiller, syrup pump couplings.

A condition relating to the syrup pump outlet couplings used on NEW001 (2-flavour carbonator) and NEW002 (2-flavour chiller) units has been identified.
Irregularities in the mating face of the syrup pump flow regulator have led to a number of push-fit coupling failures resulting in syrup product leaks within the carbonator / chiller unit.

Commencing with Serial Number 284502.

All NEW00x units are fitted with an alternative stainless steel coupling.

We recommend that field based units purchased before 11th August 2003 are retrofitted with the alternative part.

A retrofit kit containing instructions and sufficient parts for 1 syrup pump has been released, you will therefore require 2 kits per machine.

A retro fit kit is available without charge, currently under Booth Part No "1A4038."

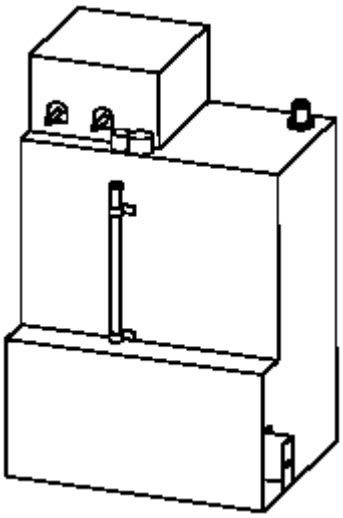

The retro kit contains full fitting instructions